



SSM 51179 2021-2022 Bronco – Multiple Warning Indicators/Messages In The IPC - Multiple Communication Fault DTCs Related To The HS-CAN2

Some 2021-2022 Bronco vehicles may experience multiple warning indicators/messages displayed in the instrument panel cluster including but is not limited to Pre-Collision Assist Not Available, Hill Start Assist Not Available and/or Front Camera Malfunction. The vehicle may also have multiple communication fault diagnostic trouble codes (DTC) setting in and/or related to the high speed control area network 2 (HS-CAN2) modules. This may be due to a loose and/or improperly seated connector C210. If the vehicle exhibits the above conditions, access and inspect connector C210 for proper attachment and/or damage and repair as necessary. If this fault persists, refer to Workshop Manual, Section 418-00A and continue with normal diagnostics. For claiming, use causal part 14290 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.